



Testing, Mitigation, System Design  
CCB 180537  
CASCARI927C1  
Fed ID 26-1809992

12839 NE Airport Way, Building 9  
Portland, Oregon 97230  
Phone: (503) 421-4813  
Fax: (503) 281-6170  
Office@CascadeRadon.com

## Radon Survey Analysis Job #22-C104F

for

Lake Oswego School District  
Lake Oswego Junior High School  
c/o Brent Paul

property located at

2500 Country Club Road  
Lake Oswego, OR 97034

June 27, 2023

## Introduction

The following report documents a study of radon levels for the property located at 2500 Country Club Road Lake Oswego, OR 97034. The goal of this study is to determine indoor radon levels for all areas tested, testing performed per Oregon Health Authority School Testing Protocols.

## Conclusions and Recommendations

Test was a "Long-Term" test, with minimum duration of 91 days. See the chart below of areas in buildings that were tested, and the corresponding levels found. Maps of the test levels are provided in Appendix A. Note that two(2) of the three(3) locations tested had results above the USEPA Action Level of 4.0 pCi/L.

It is recommended that a certified radon mitigation company be contacted to evaluate the areas which are elevated to determine appropriate mitigation action to bring them below the USEPA Action Level.

While the USEPA recommends buildings be fixed if the radon level is 4.0 pCi/L or more, because there is no known safe level of exposure to radon, the US EPA also suggests individuals consider fixing buildings for radon levels between 2.0 pCi/L and 4.0 pCi/L.

This report represents the average radon concentration for the period that testing was and at the specific location(s) within the building. The concentration of radon gas in indoor air can vary widely; it fluctuates daily, seasonally, and with weather conditions. Indoor radon levels may be affected by barometric pressure, strong winds, rain-soaked ground, snow cover, heating and A/C systems, building construction, open windows, and the like.

NOTE: It is recommended from the Oregon Health Authority that any school indicating low radon values be retested at least every 10 years. In areas where mitigation has been performed, it is recommended to test using long-term testing at least every 5 years.

## Radon Level Measurements

The building tested was assumed occupied during testing.

The measurement technique used five(5) long term Alpha-Track Detectors

Test Start Date: 11/16/2023

Test End Date: 6/13/2023

Measurements of radon levels were made in the following areas:

**Table 1: Results**

Room	Kit ID#	Uncertainty	Result (pCi/L)
Wrestling Rm	Duplicate Avg	± 3%	5.4
Workroom	414791	± 3%	4.9
Faculty Rm	414795	± 3%	2.6

Duplicate measurements were conducted as a means to assess the precision of the test measurements. The criteria of acceptance is that the average relative percent difference (ARPD) of the results of the two measurement results for results whose averages are greater than 4.0, should be within 25%. The results of the collated duplicates are provided in Table 2. The applicable ARPD for this survey was not applicable and is thus in compliance.

**Table 2: \*Duplicate Table**

Room	Kit ID#	Result (pCi/L)	Average (pCi/L)	Avg > 3.9 pCi/L?	RPD%
Wrestling Room	414751	5.4	5.4	Yes	0%
	414780	5.4			
		Average RPD for Duplicate Averages more than 3.9 pCi/L:			5.4
		In Compliance:			Yes

As a means to determine any biases in the results, detectors were deployed but not opened. At the time of test retrieval of the regular test, the devices were removed from their packaging and sent to the laboratory for blind analysis. The results of these unexposed devices are shown in Table 3. As can be seen, the laboratory reported these at the lower level of detection, indicating that no biases were introduced in handling and shipping of the devices.

**Table 3: Blanks**

Room	Kit ID#	Result (pCi/L)	In Compliance?
Faculty Room	414846	0.4 ±8%	Yes

A device was also selected from the lot of detectors that were utilized for exposure to a known radon environment at a spiking chamber (Bowser-Morner, NEHANRPP ID# 101 TC). After exposure, the device was submitted as a blind measurement to the laboratory. A comparison of the reported reading from the lab and the known concentration in the chamber is as follows:

Chamber concentration to which device was exposed:	25.7 pCi/L
Concentration reported by lab:	30.4 pCi/L ±3%
Relative percent difference (RPD):	16.8%

The RPD between the reported and spiking concentration is well within normal limits.

**Key:**


pCi/L: Picocuries per liter – units of radon concentration.

Average (Avg): Cumulative average of the entire period since the test started.

Invalid: Kit is void due to being found on floor, damaged, missing, or visibly tampered with after placement

Please contact me if you have any questions.

Thank you,  
Felicia Flanders  
NRPP 112059 RMP

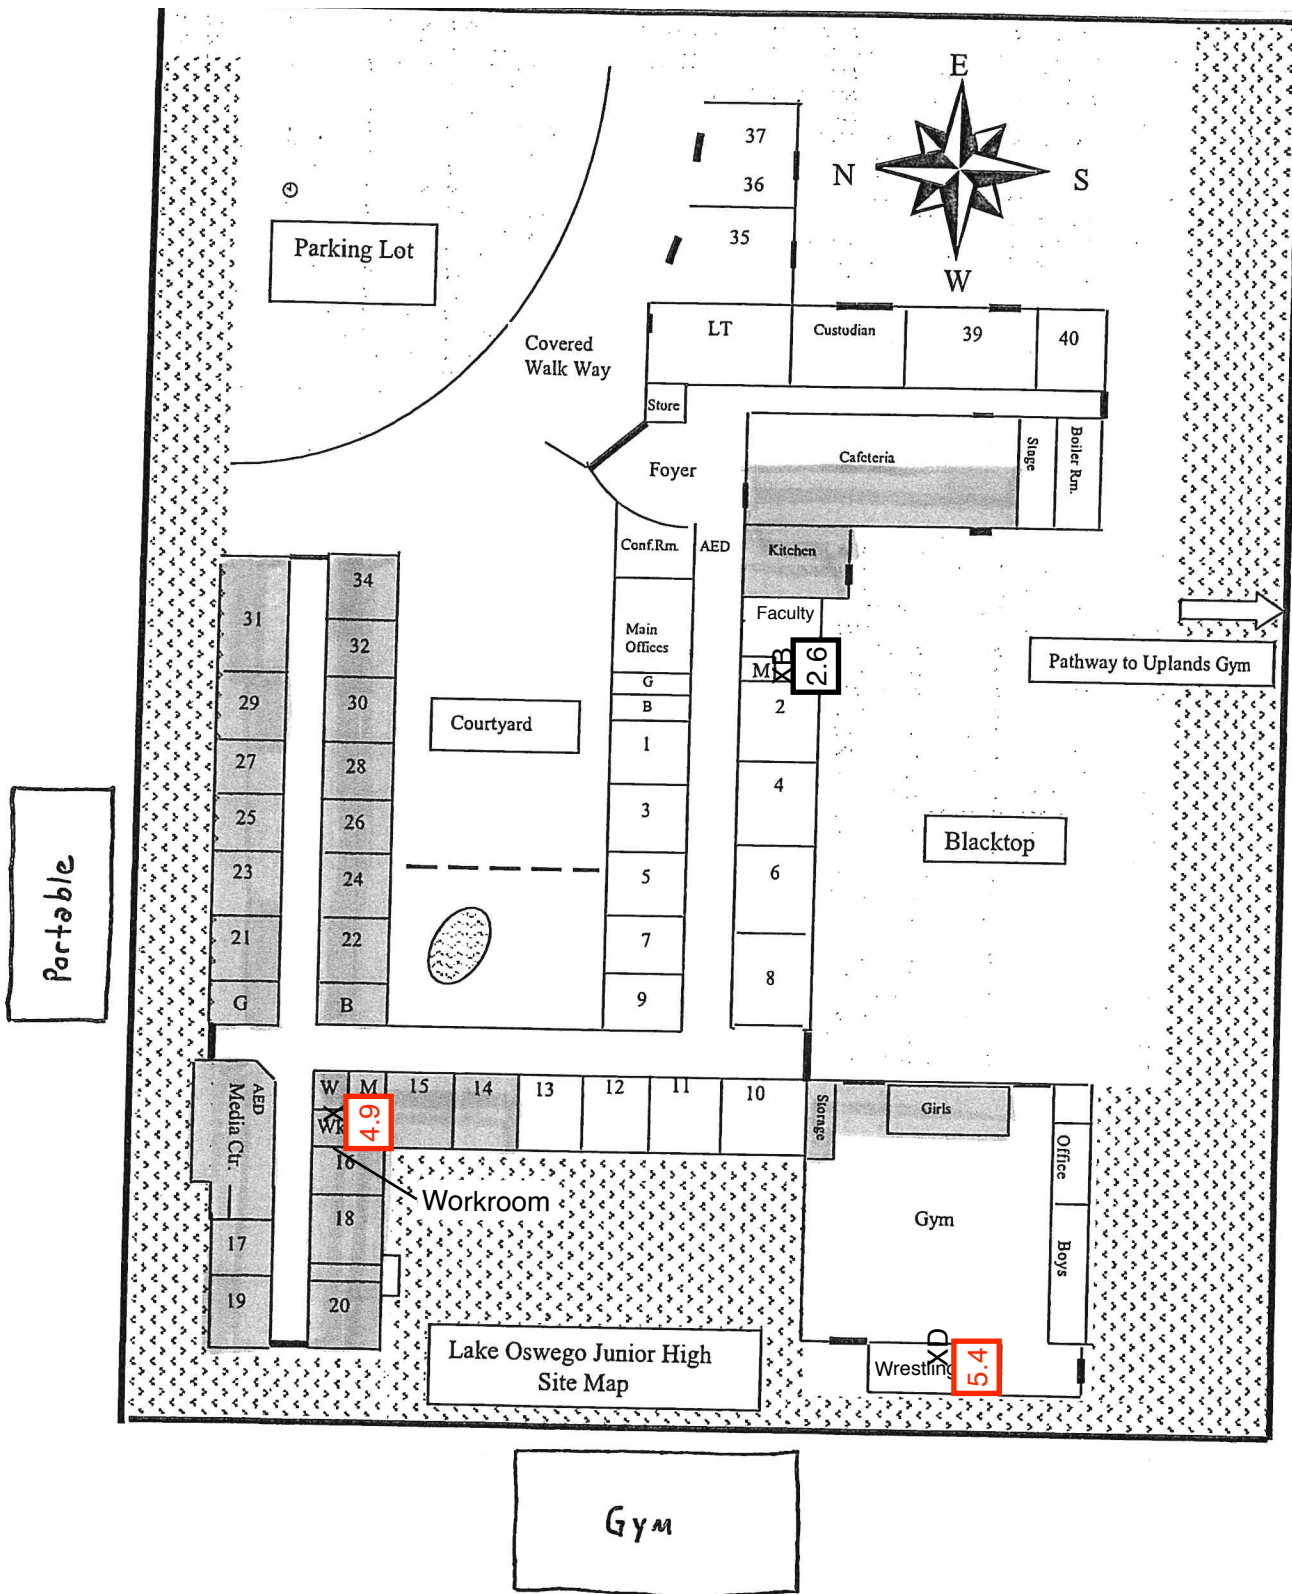

Appendix A: Map of Results - Lake Oswego Jr HS