



June 3, 2022

Brent Paul, Director of Facility Operations
Lake Oswego School District
2455 Country Club Road
Lake Oswego, Oregon 97034

Via email: paulb@loswego.k12.or.us

Regarding: Radon Testing
Palisades Elementary School
1500 Greentree Avenue
Lake Oswego, Oregon 97034
PBS Project 21600.051

Dear Mr. Paul:

From March 8 to March 10, 2022, PBS Engineering and Environmental Inc. (PBS) performed short-term radon testing at Palisades Elementary School located at 1500 Greentree Avenue in Lake Oswego, Oregon.

The Environmental Protection Agency (EPA) and Oregon Health Authority (OHA) recommend that buildings be tested for radon and that any radon concentrations be maintained below 4.0 picocuries per liter (pCi/L) of air.

PBS used Radonova brand activated charcoal adsorption detector short-term radon test kits to measure radon levels in frequently occupied rooms that are in contact with the ground or above unoccupied basements or crawl spaces. The test kits were shipped under chain-of-custody to Alpha Energy Laboratories (National Radon Proficiency Program ID: 101132 AL) for analysis.

Laboratory results indicated that all short-term radon tests at Palisades Elementary School were below 4.0 pCi/L.

See the attached laboratory analysis report for sample locations and additional details.

In addition to the EPA recommendation that radon concentrations not exceed 4.0 pCi/L, OHA recommends that the following steps be conducted based on the results of a room's initial short-term test:

- **If the result is less than 2.0 pCi/L**, school districts are required to test again every 10 years, per Oregon Revised Statute 332.166-167.
- **If the result is between 2.0 pCi/L and 4.0 pCi/L**, consider fixing (i.e., lowering) the radon in that room.
- **If the result is from 4.0 pCi/L to 8.0 pCi/L**, perform a follow-up measurement of that room using a long-term test. This test should be conducted over as much of a nine-month school year as possible, when the room is likely to be occupied. If that result is equal to or greater than 4.0 pCi/L, the radon in the room should be fixed (i.e., lowered).

- **If the initial short-term test result is equal to or greater than 8.0 pCi/L**, conduct a second short-term test and average its result with the initial short-term test result. If the average of the two is equal to or greater than 4.0 pCi/L, radon in the room should be fixed (i.e., lowered).

Note: A great difference in the results of the short-term tests may indicate a flaw in the testing process. Investigate and consider retesting. For situations in which one of the test results is equal to or greater than 4.0 pCi/L, if the higher result is two or more times the lower result, repeat the test.

LIMITATIONS OF SCOPE

This study was limited to the tests and locations as previously indicated. The site as a whole may have other environmental concerns that will not be characterized by this study. The findings and conclusions of this work are not scientific certainties, but probabilities based on professional judgment concerning the significance of the data gathered during the course of this investigation. PBS is not able to represent conditions on the site or adjoining sites beyond those detected or observed by PBS.

Please feel free to contact me at 503.417.7607 or bob.kleckner@pbsusa.com with any questions or comments.

Sincerely,

Bob Kleckner
Sr. Project Manager

Attachment: Radonova Laboratory Analysis Radon Monitoring Report
Floor Plan

SE:BK:mo

Sam Eckes

BY
PBS Engineering & Environmental

REPORT RECEIVER(S)
alex.johnson@pbsusa.com;lindsey.peterson@pbsusa.com
Sam Eckes

RADON MONITORING REPORT

Description of the measurement

The measurement was performed with an Activated Charcoal Adsorption detector (QuickScreen) and was analyzed by Alpha Energy Laboratories (NRPP ID: 101132 AL).

The detector(s) arrived to Alpha Energy Laboratories, Inc. **03/15/2022**.
They were measured **03/15/2022**.

No person has signed the record card and verified that the instructions have been followed.

Property data and address

MEASURE SITE ADDRESS
Lake Oswego SD
1500 Greentree ave
Lake Oswego 97034

BUILDING ID
Palisades ES

Test results

| DETECTOR | MEASUREMENT PERIOD | DESCRIPTION / LOCATION | FLOOR | RADON RESULT |
|---------------------------|---|---|-------|-----------------|
| RK109795 [QuickScreen] | 03/08/2022 07:14 AM – 03/10/2022 02:41 PM | Bond office/science resource CR24, on shelf next to outlets | First | 0.6 ± 0.5 pCi/L |
| RK109814 [QuickScreen] | 03/08/2022 07:16 AM – 03/10/2022 02:42 PM | Student Services district office CR, admin desk in middle | First | < 0.5 pCi/L |
| RK109783 [QuickScreen] | 03/08/2022 07:19 AM – 03/10/2022 02:42 PM | Student Services district office CR, "office 1, desk" | First | < 0.9 pCi/L |

Comment to the results

Tryggve Rönqvist (Electronically signed)

Signature Radonova Laboratories Laboratory Measurement Specialist

This report may only be reproduced in full, unless issuing laboratory has given prior written approval.

DISCLAIMER

Radonova Inc. makes no warranty of any kind, express or implied, as regard to the use, operation or analysis of any Radonova Inc. monitor. Radonova Inc. specifically disclaims implied warranties of merchantability and fitness for a particular purpose. Radonova Inc. is not responsible for any damage, including consequential damages, to persons or property resulting from the use of the monitor or the resulting data.

RADONOVA INC.
900 Oakmont Lane Suite 207
Westmont IL 60559
331.814.2200, help@radonova.com

Sam Eckes

BY
PBS Engineering & Environmental

REPORT RECEIVER(S)
alex.johnson@pbsusa.com;lindsey.peterson@pbsusa.com
Sam Eckes

RADON MONITORING REPORT

Description of the measurement

The measurement was performed with an Activated Charcoal Adsorption detector (QuickScreen) and was analyzed by Alpha Energy Laboratories (NRPP ID: 101132 AL).

The detector(s) arrived to Alpha Energy Laboratories, Inc. **03/15/2022**.
They were measured **03/15/2022**.

No person has signed the record card and verified that the instructions have been followed.

Property data and address

MEASURE SITE ADDRESS
Lake Oswego SD
1500 Greentree ave
Lake Oswego 97034

BUILDING ID
Palisades ES

| DETECTOR | MEASUREMENT PERIOD | DESCRIPTION / LOCATION | FLOOR | RADON RESULT |
|---------------------------|---|---|-------|--------------|
| RK109800 [QuickScreen] | 03/08/2022 07:20 AM – 03/10/2022 02:42 PM | Student Services district office CR, "office 2, BS" | First | < 1.0 pCi/L |
| RK109817 [QuickScreen] | 03/08/2022 07:21 AM – 03/10/2022 02:42 PM | Student Services district office CR, "office 3, FC" | First | < 0.8 pCi/L |
| RK109786 [QuickScreen] | 03/08/2022 07:22 AM – 03/10/2022 02:43 PM | Student Services district office CR, "office 4, desk" | First | < 0.7 pCi/L |
| RK109802 [QuickScreen] | 03/08/2022 07:23 AM – 03/10/2022 02:43 PM | Student services CR 26, next to aloe plant | First | < 0.5 pCi/L |

Comment to the results

Tryggve Rönqvist (Electronically signed)

Signature Radonova Laboratories Laboratory Measurement Specialist

This report may only be reproduced in full, unless issuing laboratory has given prior written approval.

DISCLAIMER

Radonova Inc. makes no warranty of any kind, express or implied, as regard to the use, operation or analysis of any Radonova Inc. monitor. Radonova Inc. specifically disclaims implied warranties of merchantability and fitness for a particular purpose. Radonova Inc. is not responsible for any damage, including consequential damages, to persons or property resulting from the use of the monitor or the resulting data.

RADONOVA INC.

900 Oakmont Lane Suite 207
Westmont IL 60559
331.814.2200, help@radonova.com

Sam Eckes

BY
PBS Engineering & Environmental

REPORT RECEIVER(S)
alex.johnson@pbsusa.com;lindsey.peterson@pbsusa.com
Sam Eckes

RADON MONITORING REPORT

Description of the measurement

The measurement was performed with an Activated Charcoal Adsorption detector (QuickScreen) and was analyzed by Alpha Energy Laboratories (NRPP ID: 101132 AL).

The detector(s) arrived to Alpha Energy Laboratories, Inc. **03/15/2022**.
They were measured **03/15/2022**.

No person has signed the record card and verified that the instructions have been followed.

Property data and address

MEASURE SITE ADDRESS
Lake Oswego SD
1500 Greentree ave
Lake Oswego 97034

BUILDING ID
Palisades ES

| DETECTOR | MEASUREMENT PERIOD | DESCRIPTION / LOCATION | FLOOR | RADON RESULT |
|---------------------------|---|--|-------|--------------|
| RK109820 [QuickScreen] | 03/08/2022 07:24 AM – 03/10/2022 02:44 PM | Student services CR 27, tan filing cabinet | First | < 0.7 pCi/L |
| RK109798 [QuickScreen] | 03/08/2022 07:26 AM – 03/10/2022 02:41 PM | Bond office CR 23, black end table with flowers | First | < 0.6 pCi/L |
| RK109792 [QuickScreen] | 03/08/2022 07:27 AM – 03/10/2022 02:40 PM | Bond office CR 22, tan filing cabinet | First | < 0.7 pCi/L |
| RK109781 [QuickScreen] | 03/08/2022 07:29 AM – 03/10/2022 02:39 PM | "Bond office CR 22, office 1", from table under TV | First | < 0.6 pCi/L |

Comment to the results

Trygve Rönqvist (Electronically signed)

Signature Radonova Laboratories Laboratory Measurement Specialist

This report may only be reproduced in full, unless issuing laboratory has given prior written approval.

DISCLAIMER

Radonova Inc. makes no warranty of any kind, express or implied, as regard to the use, operation or analysis of any Radonova Inc. monitor. Radonova Inc. specifically disclaims implied warranties of merchantability and fitness for a particular purpose. Radonova Inc. is not responsible for any damage, including consequential damages, to persons or property resulting from the use of the monitor or the resulting data.

RADONOVA INC.

900 Oakmont Lane Suite 207
Westmont IL 60559
331.814.2200, help@radonova.com

Sam Eckes

BY
PBS Engineering & Environmental

REPORT RECEIVER(S)
alex.johnson@pbsusa.com;lindsey.peterson@pbsusa.com
Sam Eckes

RADON MONITORING REPORT

Description of the measurement

The measurement was performed with an Activated Charcoal Adsorption detector (QuickScreen) and was analyzed by Alpha Energy Laboratories (NRPP ID: 101132 AL).

The detector(s) arrived to Alpha Energy Laboratories, Inc. **03/15/2022**.
They were measured **03/15/2022**.

No person has signed the record card and verified that the instructions have been followed.

Property data and address

MEASURE SITE ADDRESS
Lake Oswego SD
1500 Greentree ave
Lake Oswego 97034

BUILDING ID
Palisades ES

| DETECTOR | MEASUREMENT PERIOD | DESCRIPTION / LOCATION | FLOOR | RADON RESULT |
|---------------------------|---|---|-------|--------------|
| RK109784 [QuickScreen] | 03/08/2022 07:30 AM – 03/10/2022 02:38 PM | "Bond office CR 22, office 2", on desk | First | < 0.9 pCi/L |
| RK109790 [QuickScreen] | 03/08/2022 07:31 AM – 03/10/2022 02:37 PM | "CR 21, swigard", top of white cubbies | First | < 0.7 pCi/L |
| RK109806 [QuickScreen] | 03/08/2022 07:32 AM – 03/10/2022 02:36 PM | CR 20, under lamp at front desk | First | < 0.8 pCi/L |
| RK109813 [QuickScreen] | 03/08/2022 07:34 AM – 03/10/2022 02:35 PM | Maintenance office, "behind green and white box, top of | First | < 0.8 pCi/L |

Comment to the results

Trygve Rönqvist (Electronically signed)

Signature Radonova Laboratories Laboratory Measurement Specialist

This report may only be reproduced in full, unless issuing laboratory has given prior written approval.

DISCLAIMER

Radonova Inc. makes no warranty of any kind, express or implied, as regard to the use, operation or analysis of any Radonova Inc. monitor. Radonova Inc. specifically disclaims implied warranties of merchantability and fitness for a particular purpose. Radonova Inc. is not responsible for any damage, including consequential damages, to persons or property resulting from the use of the monitor or the resulting data.

RADONOVA INC.
900 Oakmont Lane Suite 207
Westmont IL 60559
331.814.2200, help@radonova.com

Sam Eckes

BY
PBS Engineering & Environmental

REPORT RECEIVER(S)
alex.johnson@pbsusa.com;lindsey.peterson@pbsusa.com
Sam Eckes

RADON MONITORING REPORT

Description of the measurement

The measurement was performed with an Activated Charcoal Adsorption detector (QuickScreen) and was analyzed by Alpha Energy Laboratories (NRPP ID: 101132 AL).

The detector(s) arrived to Alpha Energy Laboratories, Inc. **03/15/2022**.
They were measured **03/15/2022**.

No person has signed the record card and verified that the instructions have been followed.

Property data and address

MEASURE SITE ADDRESS
Lake Oswego SD
1500 Greentree ave
Lake Oswego 97034

BUILDING ID
Palisades ES

| DETECTOR | MEASUREMENT PERIOD | DESCRIPTION / LOCATION | FLOOR | RADON RESULT |
|------------------------|---|--|-------|--------------|
| RK109818 [QuickScreen] | 03/08/2022 07:36 AM – 03/10/2022 02:34 PM | Kitchen, top of microwave | First | < 0.8 pCi/L |
| RK109804 [QuickScreen] | 03/08/2022 07:38 AM – 03/10/2022 02:34 PM | Kitchen office, bookshelf | First | < 0.6 pCi/L |
| RK109832 [QuickScreen] | 03/08/2022 07:39 AM – 03/10/2022 02:33 PM | CR 19, on white cubbies | First | < 0.6 pCi/L |
| RB105406 [QuickScreen] | 03/08/2022 07:41 AM – 03/10/2022 02:47 PM | Gym, table inside right doors | First | < 1.3 pCi/L |
| RB105195 [QuickScreen] | 03/08/2022 07:41 AM – 03/10/2022 02:48 PM | Stage, "top of ds, assembled drum kit" | First | < 1.0 pCi/L |
| RB105360 [QuickScreen] | 03/08/2022 07:46 AM – 03/10/2022 02:49 PM | PE office, desk | First | < 0.9 pCi/L |
| RB105378 [QuickScreen] | 03/08/2022 07:48 AM – 03/10/2022 02:31 PM | Library CR17, behind computer next to door | First | < 0.8 pCi/L |
| RB105412 [QuickScreen] | 03/08/2022 07:49 AM – 03/10/2022 02:31 PM | Library work room CR16, paper towel holder | First | < 0.5 pCi/L |

Comment to the results

Trygve Rönqvist (Electronically signed)

Signature Radonova Laboratories Laboratory Measurement Specialist

This report may only be reproduced in full, unless issuing laboratory has given prior written approval.

DISCLAIMER

Radonova Inc. makes no warranty of any kind, express or implied, as regard to the use, operation or analysis of any Radonova Inc. monitor. Radonova Inc. specifically disclaims implied warranties of merchantability and fitness for a particular purpose. Radonova Inc. is not responsible for any damage, including consequential damages, to persons or property resulting from the use of the monitor or the resulting data.

RADONOVA INC.
900 Oakmont Lane Suite 207
Westmont IL 60559
331.814.2200, help@radonova.com

Sam Eckes

BY
PBS Engineering & Environmental

REPORT RECEIVER(S)
alex.johnson@pbsusa.com;lindsey.peterson@pbsusa.com
Sam Eckes

RADON MONITORING REPORT

Description of the measurement

The measurement was performed with an Activated Charcoal Adsorption detector (QuickScreen) and was analyzed by Alpha Energy Laboratories (NRPP ID: 101132 AL).

The detector(s) arrived to Alpha Energy Laboratories, Inc. **03/15/2022**.
They were measured **03/15/2022**.

No person has signed the record card and verified that the instructions have been followed.

Property data and address

MEASURE SITE ADDRESS
Lake Oswego SD
1500 Greentree ave
Lake Oswego 97034

BUILDING ID
Palisades ES

| DETECTOR | MEASUREMENT PERIOD | DESCRIPTION / LOCATION | FLOOR | RADON RESULT |
|------------------------|---|---------------------------------|-------|--------------|
| RB105355 [QuickScreen] | 03/08/2022 07:50 AM – 03/10/2022 02:50 PM | CR 31, paper towel holder | First | < 1.0 pCi/L |
| RB105407 [QuickScreen] | 03/08/2022 07:53 AM – 03/10/2022 02:51 PM | CR 32, top of far white cubbies | First | < 0.7 pCi/L |
| RB105383 [QuickScreen] | 03/08/2022 07:54 AM – 03/10/2022 02:52 PM | CR 33, top of white cubbies | First | < 1.1 pCi/L |
| RB105415 [QuickScreen] | 03/08/2022 07:56 AM – 03/10/2022 02:30 PM | CR 15, top of white cubbies | First | < 1.3 pCi/L |
| RB105397 [QuickScreen] | 03/08/2022 07:58 AM – 03/10/2022 02:30 PM | CR 14, shelf above sink | First | < 0.9 pCi/L |
| RB104461 [QuickScreen] | 03/08/2022 08:00 AM – 03/10/2022 02:29 PM | CR 13, paper towel holder | First | < 1.0 pCi/L |
| RB104471 [QuickScreen] | 03/08/2022 08:02 AM – 03/10/2022 02:28 PM | CR 12, paper towel holder | First | < 0.8 pCi/L |
| RB104508 [QuickScreen] | 03/08/2022 08:03 AM – 03/10/2022 02:27 PM | CR 11, paper towel holder | First | < 0.5 pCi/L |

Comment to the results

Tryggve Rönqvist (Electronically signed)

Signature Radonova Laboratories Laboratory Measurement Specialist

This report may only be reproduced in full, unless issuing laboratory has given prior written approval.

DISCLAIMER

Radonova Inc. makes no warranty of any kind, express or implied, as regard to the use, operation or analysis of any Radonova Inc. monitor. Radonova Inc. specifically disclaims implied warranties of merchantability and fitness for a particular purpose. Radonova Inc. is not responsible for any damage, including consequential damages, to persons or property resulting from the use of the monitor or the resulting data.

RADONOVA INC.

900 Oakmont Lane Suite 207
Westmont IL 60559
331.814.2200, help@radonova.com

Sam Eckes

BY
PBS Engineering & Environmental

REPORT RECEIVER(S)
alex.johnson@pbsusa.com;lindsey.peterson@pbsusa.com
Sam Eckes

RADON MONITORING REPORT

Description of the measurement

The measurement was performed with an Activated Charcoal Adsorption detector (QuickScreen) and was analyzed by Alpha Energy Laboratories (NRPP ID: 101132 AL).

The detector(s) arrived to Alpha Energy Laboratories, Inc. **03/15/2022**.
They were measured **03/15/2022**.

No person has signed the record card and verified that the instructions have been followed.

Property data and address

MEASURE SITE ADDRESS
Lake Oswego SD
1500 Greentree ave
Lake Oswego 97034

BUILDING ID
Palisades ES

| DETECTOR | MEASUREMENT PERIOD | DESCRIPTION / LOCATION | FLOOR | RADON RESULT |
|------------------------|---|--|-------|--------------|
| RB105439 [QuickScreen] | 03/08/2022 08:07 AM – 03/10/2022 02:55 PM | CR 9, wifi router on inside wall | First | < 1.0 pCi/L |
| RB105432 [QuickScreen] | 03/08/2022 08:08 AM – 03/10/2022 02:56 PM | CR 8, behind walkie talkie | First | < 0.9 pCi/L |
| RB105402 [QuickScreen] | 03/08/2022 08:11 AM – 03/10/2022 09:59 PM | CR 2 intervention, bookshelf by door | First | < 1.2 pCi/L |
| RB104490 [QuickScreen] | 03/08/2022 08:12 AM – 03/10/2022 02:59 PM | Music classroom 1, paper towel holder | First | < 0.5 pCi/L |
| RB105434 [QuickScreen] | 03/08/2022 08:12 AM – 03/10/2022 02:59 PM | Music classroom, paper towel holder / DUP | First | < 0.9 pCi/L |
| RB105424 [QuickScreen] | 03/08/2022 08:17 AM – 03/10/2022 03:00 PM | Workroom by front office, above sink | First | < 1.3 pCi/L |
| RB104527 [QuickScreen] | 03/08/2022 08:17 AM – 03/10/2022 03:00 PM | Workroom by front office, above sink / DUP | First | < 0.9 pCi/L |
| RB104446 [QuickScreen] | 03/08/2022 08:20 AM – 03/10/2022 03:02 PM | Main office, cabinets under clock | First | < 0.8 pCi/L |

Comment to the results

Trygve Rönqvist (Electronically signed)

Signature Radonova Laboratories Laboratory Measurement Specialist

This report may only be reproduced in full, unless issuing laboratory has given prior written approval.

DISCLAIMER

Radonova Inc. makes no warranty of any kind, express or implied, as regard to the use, operation or analysis of any Radonova Inc. monitor. Radonova Inc. specifically disclaims implied warranties of merchantability and fitness for a particular purpose. Radonova Inc. is not responsible for any damage, including consequential damages, to persons or property resulting from the use of the monitor or the resulting data.

RADONOVA INC.

900 Oakmont Lane Suite 207
Westmont IL 60559
331.814.2200, help@radonova.com

Sam Eckes

BY
PBS Engineering & Environmental

REPORT RECEIVER(S)
alex.johnson@pbsusa.com;lindsey.peterson@pbsusa.com
Sam Eckes

RADON MONITORING REPORT

Description of the measurement

The measurement was performed with an Activated Charcoal Adsorption detector (QuickScreen) and was analyzed by Alpha Energy Laboratories (NRPP ID: 101132 AL).

The detector(s) arrived to Alpha Energy Laboratories, Inc. **03/15/2022**.
They were measured **03/15/2022**.

No person has signed the record card and verified that the instructions have been followed.

Property data and address

MEASURE SITE ADDRESS
Lake Oswego SD
1500 Greentree ave
Lake Oswego 97034

BUILDING ID
Palisades ES

| DETECTOR | MEASUREMENT PERIOD | DESCRIPTION / LOCATION | FLOOR | RADON RESULT |
|------------------------|---|--|-------|--------------|
| RB104814 [QuickScreen] | 03/08/2022 08:20 AM – 03/10/2022 03:02 PM | Main office, cabinets under clock / DUP | First | < 0.5 pCi/L |
| RB104803 [QuickScreen] | 03/08/2022 08:22 AM – 03/10/2022 02:58 PM | Staff room, on bookshelf under clock | First | < 1.0 pCi/L |
| RB105177 [QuickScreen] | 03/08/2022 08:22 AM – 03/10/2022 02:58 PM | Staff room, on bookshelf under clock / DUP | First | < 1.0 pCi/L |
| RB104518 [QuickScreen] | 03/08/2022 08:26 AM – 03/10/2022 03:03 PM | Principals office, bookshelf | First | < 0.8 pCi/L |
| RB104504 [QuickScreen] | 03/08/2022 08:26 AM – 03/10/2022 03:03 PM | Principals office, bookshelf / DUP | First | < 0.7 pCi/L |
| RB104776 [QuickScreen] | 03/08/2022 08:27 AM – 03/10/2022 03:04 PM | Nurses office, high on cabinet | First | < 0.8 pCi/L |
| RK109603 [QuickScreen] | 03/08/2022 03:05 PM – 03/10/2022 03:05 PM | Field blank | First | < 0.7 pCi/L |

Comment to the results

Trygve Rönqvist (Electronically signed)

Signature Radonova Laboratories Laboratory Measurement Specialist

This report may only be reproduced in full, unless issuing laboratory has given prior written approval.

DISCLAIMER

Radonova Inc. makes no warranty of any kind, express or implied, as regard to the use, operation or analysis of any Radonova Inc. monitor. Radonova Inc. specifically disclaims implied warranties of merchantability and fitness for a particular purpose. Radonova Inc. is not responsible for any damage, including consequential damages, to persons or property resulting from the use of the monitor or the resulting data.

RADONOVA INC.
900 Oakmont Lane Suite 207
Westmont IL 60559
331.814.2200, help@radonova.com

Sam Eckes

BY
PBS Engineering & Environmental

REPORT RECEIVER(S)
alex.johnson@pbsusa.com;lindsey.peterson@pbsusa.com
Sam Eckes

RADON MONITORING REPORT

Description of the measurement

The measurement was performed with an Activated Charcoal Adsorption detector (QuickScreen) and was analyzed by Alpha Energy Laboratories (NRPP ID: 101132 AL).

The detector(s) arrived to Alpha Energy Laboratories, Inc. **03/15/2022**.
They were measured **03/15/2022**.

No person has signed the record card and verified that the instructions have been followed.

Property data and address

MEASURE SITE ADDRESS
Lake Oswego SD
1500 Greentree ave
Lake Oswego 97034

BUILDING ID
Palisades ES

| DETECTOR | MEASUREMENT PERIOD | DESCRIPTION / LOCATION | FLOOR | RADON RESULT |
|------------------------|---|------------------------|-------|--------------|
| RK109648 [QuickScreen] | 03/08/2022 03:05 PM – 03/10/2022 03:06 PM | Field blank | First | < 0.7 pCi/L |
| RK109623 [QuickScreen] | 03/08/2022 03:05 PM – 03/10/2022 03:07 PM | Field blank | First | < 0.8 pCi/L |

Comment to the results

Trygve Rönqvist (Electronically signed)

Signature Radonova Laboratories Laboratory Measurement Specialist

This report may only be reproduced in full, unless issuing laboratory has given prior written approval.

DISCLAIMER

Radonova Inc. makes no warranty of any kind, express or implied, as regard to the use, operation or analysis of any Radonova Inc. monitor. Radonova Inc. specifically disclaims implied warranties of merchantability and fitness for a particular purpose. Radonova Inc. is not responsible for any damage, including consequential damages, to persons or property resulting from the use of the monitor or the resulting data.

RADONOVA INC.
900 Oakmont Lane Suite 207
Westmont IL 60559
331.814.2200, help@radonova.com

Measurement method: Activated Charcoal Adsorption

For this method using the QuickScreen detector, the airtight container with activated charcoal is opened in the area to be sampled and radon in the air adsorbs onto the charcoal granules. At the end of the sampling period, the container is sealed and may be sent to a laboratory for analysis. The gamma decay from the radon adsorbed to the charcoal is counted on a scintillation detector and a calculation based on calibration information is used to calculate the radon concentration at the sample site.

Measured radon concentrations

For each detector, the measured value of the radon concentration is provided. For each value an uncertainty associated with the measurement to a 95% confidence level is also provided. For example a measurement result of 4.0 ± 0.5 pCi/L means that the radon concentration is most likely contained in the range 3.5 - 4.5 pCi/L. If the start or end date of the measurement has not been provided, the radon concentration cannot be calculated. In such cases, the total exposure in pCi*days/L will be reported. The reported measured values are related to the detectors as received by Radonova Laboratories. Detector deployment is not performed by Radonova Laboratories. Measurement information such as monitoring period (dates) and placement location is provided to Radonova Laboratories by the end user.

Codes on non-reportable detectors

DNR Not Reported – Detector Not Returned
ERR Not Reported – See comment

Radon measurements in Multifamily Buildings, Schools and Large Buildings

The United States Environmental Protection Agency (EPA) recommends remediation if the results of one long-term test or the average of two short-term tests conducted in an occupied room are 4.0 pCi/L or higher. The average yearly residential indoor radon level in the US is estimated to be around 1.3 pCi/L. Long-term tests are conducted for more than 90 days. Short-term tests are conducted between 2 and 90 days and should be performed under closed building conditions.

If an initial short-term test result is less than 4 pCi/L, a follow-up measurement is probably not needed.

If an initial short-term test result is between 4 pCi/L and 8 pCi/L, a long-term or a short-term follow-up measurement is recommended.

If an initial short-term test result is greater than 8 pCi/L, a short term follow-up measurement is recommended in order to get a fast result.

More information about radon measurements and mitigation can be found in the AARST and EPA publications:

- ANSI/AARST Protocol for Conducting Measurements of Radon and Radon-Decay Products in Schools and Large Buildings.
- ANSI/AARST Protocol for Conducting Radon and Radon Decay Product Measurements in Multifamily Buildings.
- ANSI/AARST Radon Mitigation Standards for Schools and Large Buildings.
- ANSI/AARST Radon Mitigation Standards for Multifamily Buildings.
- EPA Radon Measurements in Schools, EPA 402-R-92-014, July 1993.

For more information about the interpretation of your test results or about other radon related issues we suggest contacting your state radon office.

Signature on the report

With the signature on the report, the Measurement specialist at Radonova Laboratories certifies that the quality control procedures follows the guidance in accordance with EPA 402-R-95-012. Measurement information displayed in italics on report has been provided by the customer.

Certification no:

101132-AL, 107830-RT, NY ELAP ID: 11430

DISCLAIMER


Radonova Inc. makes no warranty of any kind, express or implied, as regard to the use, operation or analysis of any Radonova Inc. monitor. Radonova Inc. specifically disclaims implied warranties of merchantability and fitness for a particular purpose. Radonova Inc. is not responsible for any damage, including consequential damages, to persons or property resulting from the use of the monitor or the resulting data.

RADONOVA INC.

900 Oakmont Lane Suite 207
Westmont IL 60559
331.814.2200, help@radonova.com

1. THIS DRAWING IS DIAGRAMMATIC. IT IS FOR GENERAL INFORMATION AND SAMPLE LOCATIONS.

● R-# RADON TEST AND KIT NUMBER

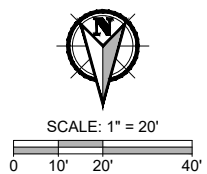

PREPARED FOR: LAKE OSWEGO SCHOOL DISTRICT #7J

FULL SIZE SHEET FORMAT IS 24X36; IF PRINTED SIZE IS NOT 24X36, THEN THIS SHEET FORMAT HAS BEEN MODIFIED & INDICATED DRAWING SCALE IS NOT ACCURATE.

Environmental Inc.
4412 S Corbett Avenue
Portland, OR 97239
503.248.1939
pbsusa.com



PALISADES ELEMENTARY SCHOOL
1500 SW GREENTREE AVENUE, LAKE OSWEGO, OREGON

[illegible]

| |
|------------------------------|
| DRAWN BY JAB |
| CHECKED: BK |
| DATE: MAY 2022 |
| PROJECT NUMBER: 21600.051 |

ET DRAWING NO:

RA15

1 OF 1